



AN AIRBUS COMPANY

OMITTED NOTIFICATION BULLETIN

NAVBLUE Reference: 2501-010

Notification Published date: 15-01-2025

Product Affected: Navigation+

Please note that the following information has not been incorporated into NAVBLUE databases for cycle 2501

The below information is under state query and has been omitted from NAVBLUE databases until the query has been resolved.

Source: Papua New Guinea (AYTB) Flight Supplement 210715 and NOTAM A0054/22

NOT IN NAVBLUE DATABASES:

Approach procedure NDB/DME (via OKT) CLOUDBREAK – Due to the relocation of Navaid by NOTAM and state has not revised this approach procedure based on the new location of OKT NDB/DME.

is awaiting state information clarification.

Source: Sudan AIRAC AIP Amd 01/22

NOT IN NAVBLUE DATABASES:

Changes to the direction of the segment KAFIA-ALMAM on airway A410 due to an outstanding state query

is awaiting state information clarification.

Source: Turkey (LTCG) AIP 231228

NOT IN NAVBLUE DATABASES:

The following SIDs have not been included in NAVBLUE databases due to insufficient state information relating to the arc radials.

BAVT1M
BAVT1U
MILQ1U
PIXA1M
PIXA1U

is awaiting state information clarification.



AN AIRBUS COMPANY

OMITTED NOTIFICATION BULLETIN

Source: Switzerland (LSMP) MIL FLIP 240321

NOT IN NAVBLUE DATABASES:

RNP RWY 05 has not been included in NAVBLUE databases due to missing publication data.

is awaiting state information clarification.

Source: South Korea (RKPC) AIRAC AMD 06-24

NOT IN NAVBLUE DATABASES:

LPV Minima and the Path Point have not been included for the RNP Y RWY 07 approach.

is awaiting state information clarification.

Source: USA (KDMA) FAA IFP Information Gateway

NOT IN NAVBLUE DATABASES:

The procedures for DAVIS MONTHAN AFB (KDMA) have been withdrawn from NAVBLUE databases due to aerodrome data updates, the procedures will be made available again when the chart updates have been published.

is awaiting state information clarification.

Source: Chili (SCDA) AIRAC Supplement S14/24

NOT IN NAVBLUE DATABASES:

Runway conservation work on the extension of THR 01 (identified as THR 02) has not been incorporated into NAVBLUE databases.

is awaiting state information clarification.

Source: Nigeria AIP SUP S39/24

NOT IN NAVBLUE DATABASES:

A new Drone area is established.

Whilst attempting to code this area we have found that the coordinates do not come together to form a viable shape and there is overlapping within the given sequence of the area description.

is awaiting state information clarification.



AN AIRBUS COMPANY

OMITTED NOTIFICATION BULLETIN

Source: Nigeria AIP SUP S42/24

NOT IN NAVBLUE DATABASES:

New Unmanned Aircraft established.

Whilst attempting to code this area we have found that the coordinates do not come together to form a viable shape and there is overlapping within the given sequence of the area description.

Aeronautical data needs to be verified.

is awaiting state information clarification.

Source: Canada (CYAZ) AIRAC AMD 44/24

NOT IN NAVBLUE DATABASES:

RNAV (GNSS) RWY 16 approach has not been added to NAVBLUE databases due to an issue with the CRC value (FAS Data Block).

is awaiting state information clarification.

Source: Greece (LGTG) MIL AIP VOL 240601

NOT IN NAVBLUE DATABASES:

The ILS X RWY 28C approach has been removed from NAVBLUE databases due to chart discrepancies with the updated Localizer Bearing (ITGR). ILS W RWY 28C is available.

is awaiting state information clarification.

Source: Gambia (GBYD) AIRAC AIP Amd 01-25

NOT IN NAVBLUE DATABASES:

The following approaches have not been included in NAVBLUE databases due to the state not provided the supporting coding table and waypoint co-ordinates.

RNP RWY 14
RNP RWY 32
ILS/LOC X RWY 32

is awaiting state information clarification.

Source: Nepal (VNBW) AIRAC AIP Amd 05-24



AN AIRBUS COMPANY

OMITTED NOTIFICATION BULLETIN

NOT IN NAVBLUE DATABASES:

New Approach RNP RWY 28 (AR) has not been added to NAVBLUE databases due to an ident conflict with another approach with the same ident RNP RWY 28

is awaiting state information clarification.

Source: Brazil ROTAER AMD D52/24

NOT IN NAVBLUE DATABASES:

Please be aware, the update to SBBI RWY 18/36 length and displacement has been omitted from the database. This is because the updated displaced threshold coordinates for RWY 18/36 have not been provided by the state.

is awaiting state information clarification.